



RV Inspection

27 Aug 2026 / Geoffrey Baker

Complete

Flagged items	6	Actions	8
Inspection Type	Buyer: Pre-Purchase Inspection		
Inspection Level	Complete		
Inspection Location	Seffner FL 33584 United States		
Conducted on	27 Aug 2026 9:00 AM EDT		
Prepared by	Geoffrey Baker		
RV - Style	Class A: Diesel Pusher		
RV - Status	Vacant: RV Dealership		
RV Year, Make, Model	2022 Newmar Essex 4551		
 Photo 1			
RV Photo			
 Photo 2			
Weather	Clear		
Start Temperature	85F		

Flagged items & Actions

6 flagged, 8 actions

Flagged items

6 flagged, 5 actions

Exterior Sidewalls / Sidewall / Sidewall 1

Any Damage, Discoloration, or Deterioration?

Yes

There are chips and scratches on the front Diamond shield. In addition, the blanking cover over the Lane mobile eye is missing.



Photo 40



Photo 41



Photo 42



Photo 43



Photo 44

To do | Priority: Medium | Created by: Geoffrey Baker

Mobile Eye Lane Control

Recommend obtaining and installing the blanking cover over the mobile eye system on the front bumper.

Electrical System - 120 Volt AC & 12 Volt DC / GFCI & Polarity / Voltage

Polarity / Voltage Test - Bedroom Receptacles

Fail

The bedroom, 120 V AC receptacles in the bedside table cupboards show an open ground.

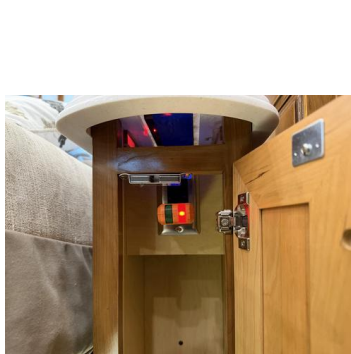


Photo 318



Photo 319

To do | Priority: High | Created by: Geoffrey Baker

Bedroom Side Table electrical outlets.

Recommend RV Electrical technician repair the 120v AC outlets in the table cabinets by the master bedroom bed to cure the Open Ground condition.

Cockpit / Other Item / Other Item 1

Item - Visual Condition

Poor

The electrical operating arm has become detached from the window. It does not work under electricity just manually.



Photo 371



Photo 372

[1FD19FD3-93B2-465B-A655-F0DE41790DCF-video.mov](https://www.youtube.com/watch?v=1FD19FD3-93B2-465B-A655-F0DE41790DCF)

To do | Priority: Medium | Created by: Geoffrey Baker

Driver's window

Recommend repairing the driver's window as needed so that it operates from the dashboard switch.

Cockpit / Other Item / Other Item 1

Item - Operation

Poor

See previous note.

Interior / Windows

Windows - Operation of Window Coverings

Fair

The nightshade over the recliners in the living room does not extend and retract with the rest of the shades adjustment. Recommend recommended.



Photo 391

To do | Priority: Low | Created by: Geoffrey Baker

Living Room Night Shade behind recliners

Service shades to adjust extension and retraction as desired.

Interior / Safety Items / Carbon Monoxide Detector / Carbon Monoxide Detector 1

Carbon Monoxide Detector - Age of Device

5-7 Years [Life Safety Issue]



Photo 424



Photo 425

To do | Priority: High | Created by: Geoffrey Baker

Carbon Monoxide Detector

Replace the CO detector and recommend labeling the expiration date on the cover for ease of inspection

Other actions

3 actions

Roof / Air Conditioner / Air Conditioner 1

Air Conditioner Cover - Visual Condition

Acceptable

Condensate was noted running across the roof.



Photo 23

To do | Priority: Medium | Created by: Geoffrey Baker

Roof AC Units

Recommend servicing the roof air-conditioning units, paying particular attention to the condensate drain lines to ensure that they are clear.

Interior / Interior Storage / Drawers

Drawers - Operation

Acceptable



Photo 404



Photo 405



Photo 406



Photo 407



Photo 408



Photo 409



Photo 410



Photo 411



Photo 412



Photo 413



Photo 414

To do | Priority: Low | Created by: Geoffrey Baker

Half Bath drawer by the toilet.

Clean out the drawer next to the toilet in the half bath.

Interior / Safety Items / Smoke Detector / Smoke Detector 1 / Smoke Detector

Smoke Detector - Test Result

Pass

To do | Priority: High | Created by: Geoffrey Baker

Smoke Detector

The battery is depleted. Replace the battery before occupying the RV.

Client Information

Client - Name John Smith

Is the Client Present? No

RV Information

Inspection Level

Complete

RV - VIN

4VZVU1E95NC*****



Photo 3

RV - Is the Manufacturer Build Sheet Available?

Yes

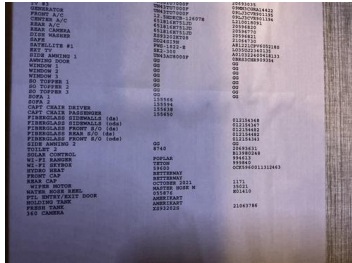


Photo 4

Roof		1 action
Was the Roof Inspected?		Yes
Inspection Level		Complete
Roof		
   Photo 5 Photo 6 Photo 7		
Roof - Visual Condition		Acceptable
Roof - Are There Areas of Possible Water Intrusion?		No
Front Cap, Joints & Seals - Visual Condition		Acceptable - Sealant exhibits little to no signs of aging
  Photo 8 Photo 9		
Trim Rail (Passenger Side / Curbside) - Visual Condition		Acceptable - Sealant exhibits little to no signs of aging
Rear Cap, Joints & Seals		Acceptable - Sealant exhibits little to no signs of aging
  Photo 10 Photo 11		
Trim Rail (Driver Side / Streetside) - Visual Condition		Acceptable - Sealant exhibits little to no signs of aging
Roof Components - Sealant Condition		Acceptable - Sealant exhibits little to no signs of aging



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21

Gutters - Visual Condition

Acceptable

Solar Panel(s) Installed

Yes

Solar Panel(s) - Visual Condition

Acceptable



Photo 22

Air Conditioner

1 action

Air Conditioner 1

1 action

Air Conditioner - Location

Roof - Front

Air Conditioner Cover - Visual Condition

Acceptable

Condensate was noted running across the roof.



Photo 23

To do | Priority: Medium | Created by: Geoffrey Baker

Roof AC Units

Recommend servicing the roof air-conditioning units, paying particular attention to the condensate drain lines to ensure that they are clear.

Air Conditioner Fins - Visual Condition

Acceptable



Photo 24

Air Conditioner 2

Air Conditioner - Location

Roof - Center

Air Conditioner Cover - Visual Condition

Acceptable



Photo 25

Air Conditioner Fins - Visual Condition

Acceptable



Photo 26

Air Conditioner 3

Air Conditioner - Location

Roof - Rear

Air Conditioner Cover - Visual Condition

Acceptable



Photo 27

Air Conditioner Fins - Visual Condition

Acceptable



Photo 28

Exterior Sidewalls	1 flagged, 1 action
Were any Exterior Sidewalls Inspected?	Yes
Inspection Level	Complete
Was a Hot Skin Test Performed?	Yes
Hot Skin Test - Was Any Voltage Recorded at or above 5 Volts AC?	No



Photo 29

Hot Skin Test - Was Any Voltage Recorded below 5 Volts AC?	No
Sidewall	1 flagged, 1 action
Sidewall 1	1 flagged, 1 action

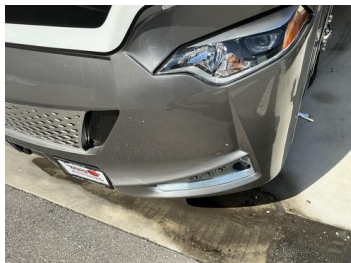
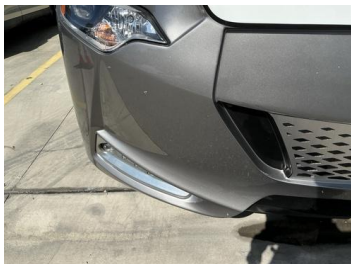
Sidewall - Location	Front Cap / Wall	
		
Photo 30	Photo 31	Photo 32
		
Photo 33	Photo 34	Photo 35

Photo 30

Photo 31

Photo 32

Photo 33

Photo 34

Photo 35



Photo 36

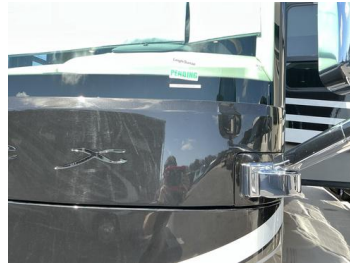


Photo 37



Photo 38



Photo 39

Any Damage, Discoloration, or Deterioration?

Yes

There are chips and scratches on the front Diamond shield. In addition, the blanking cover over the Lane mobile eye is missing.



Photo 40



Photo 41



Photo 42



Photo 43

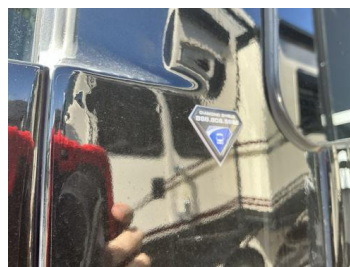


Photo 44

To do | Priority: Medium | Created by: Geoffrey Baker

Mobile Eye Lane Control

Recommend obtaining and installing the blanking cover over the mobile eye system on the front bumper.

Windows - Visual Condition

Acceptable



Photo 45



Photo 46

Cargo / Slideout Tray Shelves - Operation

Acceptable

Cargo / Access Doors - Operation

Acceptable



Photo 47



Photo 48

Cargo Interior Compartment - Visual Condition

Acceptable



Photo 49



Photo 50

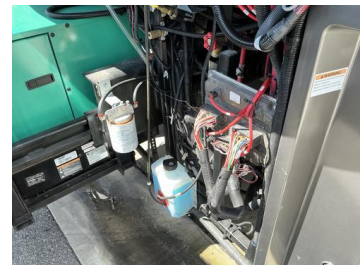


Photo 51



Photo 52



Photo 53



Photo 54



Photo 55

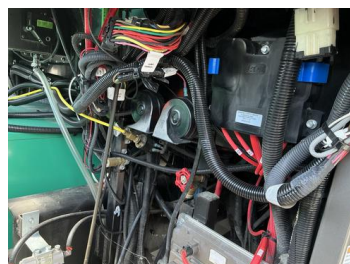


Photo 56

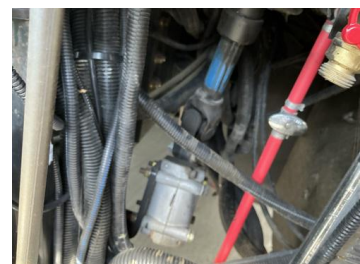


Photo 57



Photo 58

Sidewall 2

Sidewall - Location

Passenger Side / Curbside
Sidewall



Photo 59



Photo 60



Photo 61



Photo 62



Photo 63



Photo 64



Photo 65



Photo 66

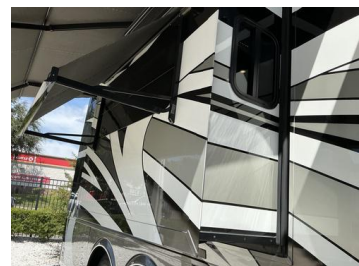


Photo 67



Photo 68



Photo 69

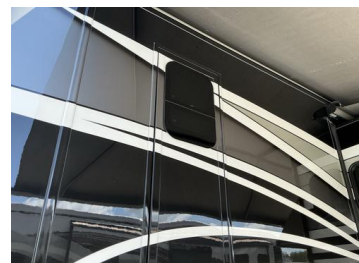


Photo 70



Photo 71

Any Damage, Discoloration, or Deterioration?

No

Windows - Visual Condition

Acceptable



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77



Photo 78

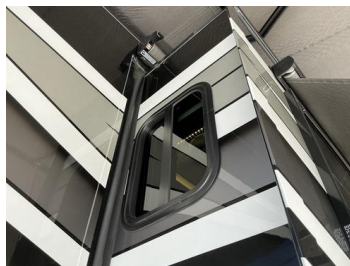


Photo 79

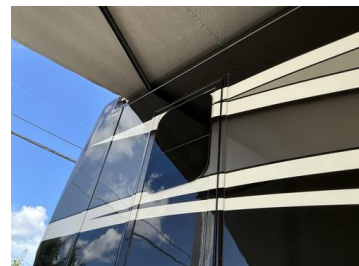


Photo 80

Cargo / Slideout Tray Shelves - Operation

Acceptable



Photo 81

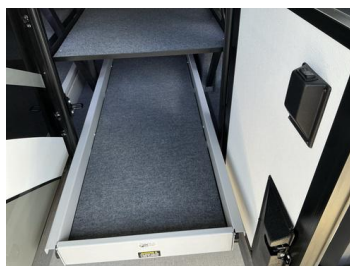


Photo 82



Photo 83

Cargo / Access Doors - Operation

Acceptable



Photo 84

Cargo Interior Compartment - Visual Condition

Acceptable



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90



Photo 91



Photo 92



Photo 93

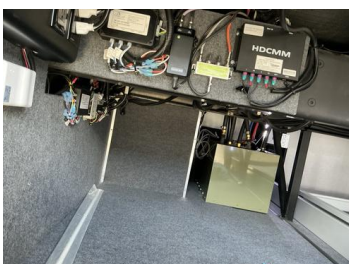


Photo 94



Photo 95

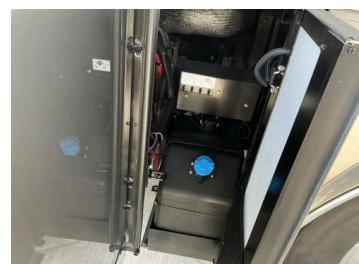


Photo 96



Photo 97



Photo 98



Photo 99



Photo 100



Photo 101

Sidewall 3

Sidewall - Location



Photo 102

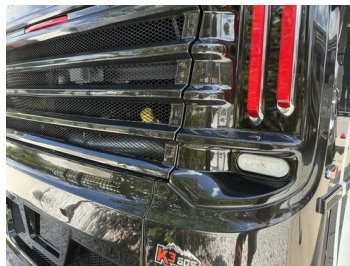


Photo 103



Photo 104

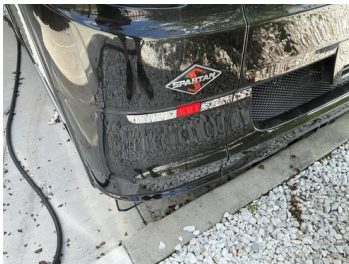


Photo 105



Photo 106



Photo 107

Rear Cap / Wall

Any Damage, Discoloration, or Deterioration?

No

Windows - Visual Condition

Not Inspected

Cargo / Slideout Tray Shelves - Operation

Not Present

Cargo / Access Doors - Operation

Acceptable



Photo 108

Cargo Interior Compartment - Visual Condition

Acceptable



Photo 109



Photo 110

Sidewall 4

Sidewall - Location

Driver Side / Streetside Sidewall



Photo 111



Photo 112



Photo 113



Photo 114



Photo 115



Photo 116



Photo 117



Photo 118



Photo 119

Any Damage, Discoloration, or Deterioration?

No

Windows - Visual Condition

Acceptable



Photo 120



Photo 121



Photo 122

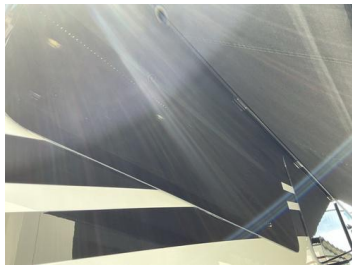


Photo 123



Photo 124



Photo 125



Photo 126

Cargo / Slideout Tray Shelves - Operation

Acceptable



Photo 127



Photo 128

[09A832A0-D82D-48A1-880B-B3834BE65999-video.mov](#)

Cargo / Access Doors - Operation

Acceptable



Photo 129

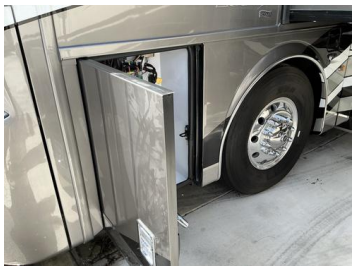


Photo 130

Cargo Interior Compartment - Visual Condition

Acceptable

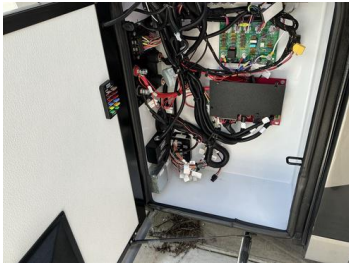


Photo 131



Photo 132



Photo 133



Photo 134



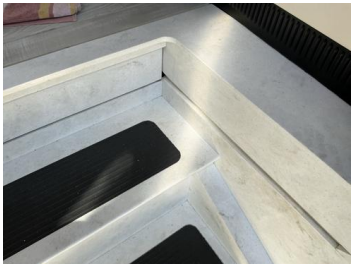
Photo 135



Photo 136



Photo 137

Entry Doors	
Were any Entry Doors Inspected?	Yes
Inspection Level	Complete
Entry Door	
Entry Door 1	
Entry Door - Location	Front
Interior Step Cover - Operation	Acceptable
  Photo 138 Photo 139	
Exterior Step System - Operation	Acceptable
  Photo 140 Photo 141	
4C860D0C-7FC7-4F11-8B1B-1D73343523E7-video.mov	
Entry Door - Operation	Acceptable
Screen Door - Operation	Acceptable
   Photo 142 Photo 143 Photo 144	
Keyless Entry Door Lock System	Yes
Keyless Entry Door Lock - Operation	Not Inspected

Keyed Door Lock / Deadbolt

Yes



Photo 145

Keyed Door Lock / Deadbolt - Operation

Acceptable

Entry Door 2

Entry Door - Location

Rear

Emergency Exit Door

Interior Step Cover - Operation

Not Inspected

Exterior Step System - Operation

Not Inspected

Entry Door - Operation

Acceptable



Photo 146



Photo 147

Screen Door - Operation

Not Inspected

Keyless Entry Door Lock System

No

Keyed Door Lock / Deadbolt

No

Awning	
Were any Awnings Inspected?	Yes
Inspection Level	Complete
Awning	
Awning 1	
Awning - Location	Passenger / Curbside - Front
Awning - Type	Patio
Awning - Operation	Acceptable
 Photo 148	
Awning 2	
Awning - Location	Passenger / Curbside - Rear
Awning - Type	Patio
Awning - Operation	Acceptable
 Photo 149	
Awning 3	
Awning - Location	Passenger / Curbside - Front
Awning - Type	Door
Awning - Operation	Acceptable



Photo 150

Awning 4

Awning - Location

Passenger / Curbside - Front
Slideout

Awning - Type

Window

Awning - Operation

Acceptable



Photo 151

Awning 5

Awning - Location

Passenger / Curbside - Rear
Slideout

Awning - Type

Window

Awning - Operation

Acceptable



Photo 152

Awning 6

Awning - Location

Driver / Streetside - Front
Slideout

Awning - Type

Window

Awning - Operation

Acceptable

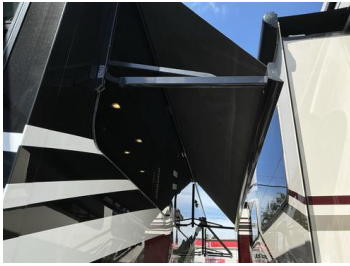


Photo 153

Awning 7

Awning - Location

Driver / Streetside - Rear Slideout

Awning - Type

Window

Awning - Operation

Acceptable



Photo 154

Slideouts

Were any Slideouts Inspected?

Yes



Photo 155

Inspection Level

Complete

Slideout

Slideout 1

Slideout - Location

Passenger / Curbside - Front

Slideout Seals, Sweeps & Gaskets - Operation

Acceptable



Photo 156



Photo 157



Photo 158

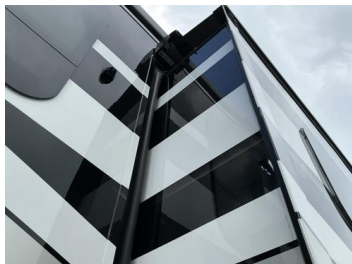


Photo 159



Photo 160

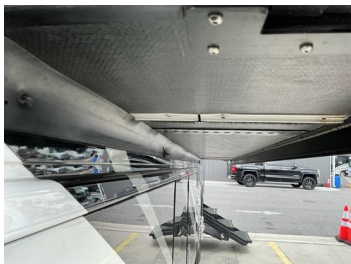


Photo 161

Slideout - Operation & Alignment

Acceptable



Photo 162

Slideout 12 Volt DC Control & Switches - Operation	Acceptable
---	------------

Slideout Roof - Visual Condition	Acceptable
---	------------

Slideout Awning Topper - Operation	Acceptable
---	------------



Photo 163

Slideout 2	
-------------------	--

Slideout - Location	Passenger / Curbside - Rear
----------------------------	-----------------------------

Slideout Seals, Sweeps & Gaskets - Operation	Acceptable
---	------------



Photo 164

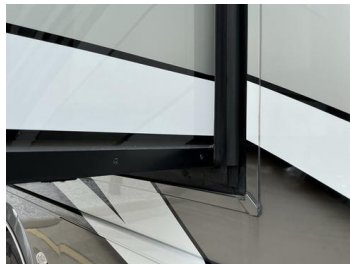


Photo 165



Photo 166



Photo 167



Photo 168



Photo 169

Slideout - Operation & Alignment	Acceptable
---	------------



Photo 170

Slideout 12 Volt DC Control & Switches - Operation	Acceptable
---	------------

Slideout Roof - Visual Condition

Acceptable

Slideout Awning Topper - Operation

Acceptable



Photo 171

Slideout 3

Slideout - Location

Driver / Streetside - Center

Slideout Seals, Sweeps & Gaskets - Operation

Acceptable



Photo 172



Photo 173



Photo 174



Photo 175



Photo 176



Photo 177

Slideout - Operation & Alignment

Acceptable



Photo 178



Photo 179

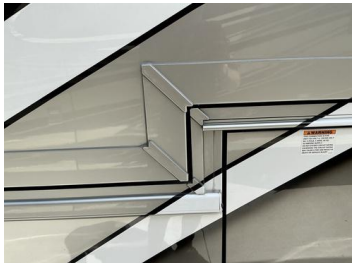


Photo 180



Photo 181

Slideout 12 Volt DC Control & Switches - Operation

Acceptable

Slideout Roof - Visual Condition

Acceptable

Slideout Awning Topper - Operation

Acceptable



Photo 182

Wheels	
Were any Wheels Inspected?	Yes
Inspection Level	Complete
Wheel Assembly	
Wheel Assembly 1	
Wheel Assembly	Front Axle - Curbside
DOT Date	Unable to Visually Verify
Tire Tread - Depth	Acceptable
 Photo 183	
Tire Wall - Visual Condition	Acceptable
 Photo 184  Photo 185  Photo 186	
Wheel Assembly 2	
Wheel Assembly	Rear Axle 1 - Curbside - Outside
DOT Date	Visually Verified
DOT Date - WW/YY	2621



Photo 187

DOT Date - Age

1-6 Years (Acceptable Age)

Tire Tread - Depth

Acceptable



Photo 188

Tire Wall - Visual Condition

Acceptable



Photo 189



Photo 190



Photo 191



Photo 192

Wheel Assembly 3

Wheel Assembly

Rear Axle 1 - Curbside - Inside

DOT Date

Unable to Visually Verify

Tire Tread - Depth

Acceptable



Photo 193

Tire Wall - Visual Condition

Not Inspected

Wheel Assembly 4

Wheel Assembly

Rear Axle 2 - Curbside - Outside

DOT Date

Unable to Visually Verify

Tire Tread - Depth

Acceptable



Photo 194

Tire Wall - Visual Condition

Acceptable



Photo 195



Photo 196



Photo 197

Wheel Assembly 5

Wheel Assembly

Rear Axle 2 - Streetside - Outside

DOT Date

Unable to Visually Verify

Tire Tread - Depth

Acceptable



Photo 198

Tire Wall - Visual Condition

Acceptable



Photo 199



Photo 200



Photo 201

Wheel Assembly 6

Wheel Assembly

Rear Axle 1 - Streetside - Outside

DOT Date

Visually Verified

DOT Date - WW/YY

2221



Photo 202

DOT Date - Age

1-6 Years (Acceptable Age)

Tire Tread - Depth

Acceptable



Photo 203

Tire Wall - Visual Condition

Acceptable



Photo 204



Photo 205



Photo 206

Wheel Assembly 7

Wheel Assembly

Rear Axle 1 - Streetside - Inside

DOT Date

Unable to Visually Verify

Tire Tread - Depth

Acceptable



Photo 207

Tire Wall - Visual Condition

Not Inspected

Wheel Assembly 8

Wheel Assembly

Front Axle - Streetside

DOT Date

Unable to Visually Verify

Tire Tread - Depth

Acceptable



Photo 208

Tire Wall - Visual Condition

Acceptable



Photo 209



Photo 210



Photo 211

Exterior Chassis & Undercarriage

Was the Exterior Chassis & Undercarriage Inspected?

Yes

Inspection Level

Complete

RV - Style

Class A: Diesel Pusher

Chassis & Frame

Chassis & Frame - Visual Condition

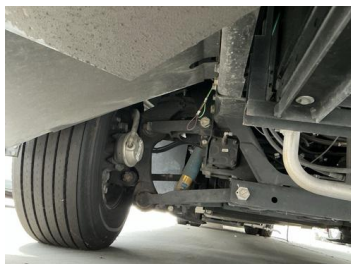


Photo 212



Photo 213

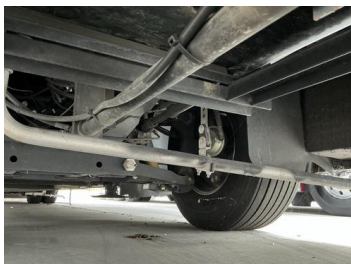


Photo 214

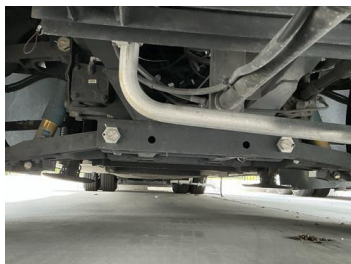


Photo 215



Photo 216



Photo 217

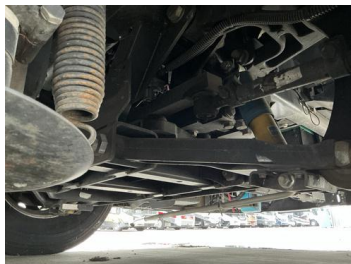


Photo 218

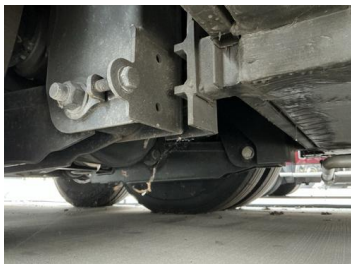


Photo 219



Photo 220

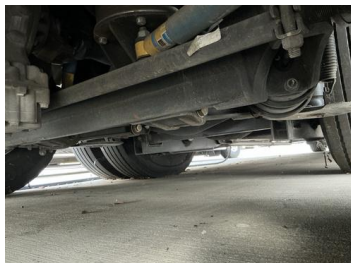


Photo 221



Photo 222

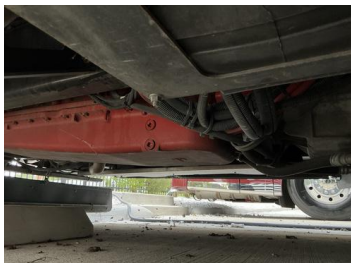


Photo 223



Photo 224

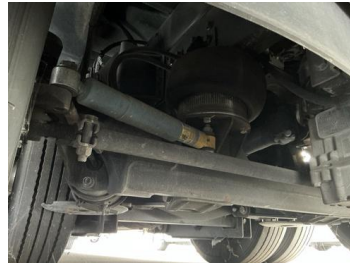


Photo 225



Photo 226



Photo 227



Photo 228



Photo 229



Photo 230



Photo 231

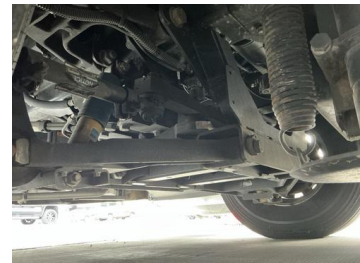


Photo 232

Chassis & Frame - Visible Signs of Rust	No
Chassis & Frame - Visible Signs of Bent or Damaged Components	No
Chassis & Frame - Visible Signs of Excessive Wear	No
Running Gear	
Running Gear - Visible Signs of Scraping or Drag Damage?	No
Running Gear - Visible Signs of Damage from Tire Failure?	No
Running Gear (Axles, Springs, Rims, other Components) - Visual Condition	Acceptable
Axles - Visible Signs of Bent or Damaged Components	No
Leaf Springs - Visual Condition	Not Inspected

Engine, Radiator & Transmission

Were the Engine and/or Radiator and/or Transmission Inspected?

Yes

Inspection Level

Complete

Engine

Engine - Mileage

10777



Photo 233



Photo 234

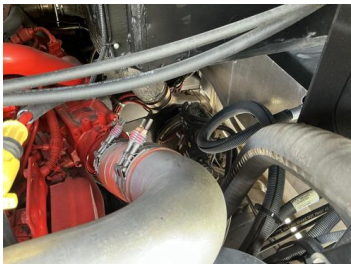


Photo 235



Photo 236

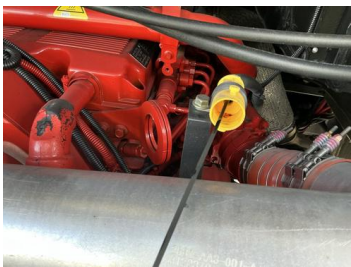


Photo 237



Photo 238



Photo 239



Photo 240



Photo 241



Photo 242



Photo 243

Engine Starts

Yes

Engine - Running Condition

Acceptable



Photo 244

Engine - Visible Signs of Oil Leaks

No

Oil Pressure Reading

Normal

Exhaust System - Exhaust Pipe / Converter / Muffler Brackets in Place

Yes



Photo 245

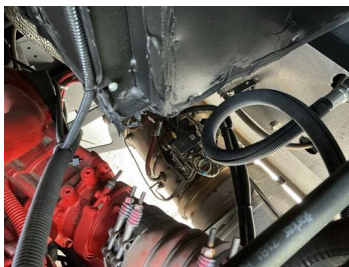


Photo 246

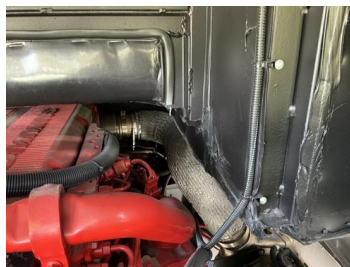


Photo 247



Photo 248

Radiator

Cooling Fan - Operational

Yes

Leveling System, Hitch-Receiver & Components

Were the Leveling System, Hitch & Components Inspected?

Yes

Inspection Level

Complete

RV - Style

Class A: Diesel Pusher

Leveling System - Operation



Photo 249



Photo 250



Photo 251



Photo 252



Photo 253



Photo 254

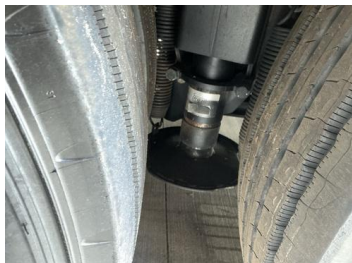


Photo 255

Do the Jacks Extend & Retract Fully?

Yes

The red jacks did not extend because the coach was parked on an unlevel site causing an excessive slope warning.

Trailer Plug / Socket

Trailer Plug / Socket 1

Is a Trailer Plug / Socket installed?

Yes

Trailer Plug / Socket - Type

7 Pin

Trailer Plug / Socket - Operation

Acceptable



Photo 256



Photo 257

Safety Items

Are Safety Chains Installed?

Not Required

Is a Breakaway Switch Installed?

Not Required

Propane Tanks, Lines & Connections

Were any of the Propane Tank, Lines & Connections Inspected?

No

All electric coach. No propane.

Chassis Lights - 12 Volt DC

Were the 12 Volt DC Chassis Lights Inspected?

Yes

Inspection Level

Complete

DOT Lights

Front Clearance Lights - Operation

Acceptable



Photo 258

Rear Clearance Lights - Operation

Acceptable



Photo 259

Driverside / Streetside - Marker Lights - Operation

Acceptable



Photo 260

Passenger Side / Curbside - Marker Lights - Operation

Acceptable

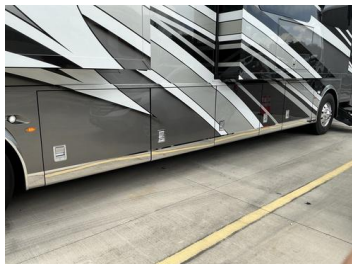


Photo 261

Left Turn / Brake Light / Marker Lights - Operation

Acceptable



Photo 262

Right Turn / Brake Light / Marker Lights - Operation

Acceptable



Photo 263



Photo 264

Backup Lights - Operation

Acceptable

Lights - Type

LED

Flood Lights - Operation

Not Inspected

Utility Lights - Operation

Not Inspected

Compartment Lights - Operation

Acceptable

Hitch Lights - Operation

Not Inspected

Porch Lights - Operation

Acceptable



Photo 265

Security Lights - Operation

Acceptable



Photo 266



Photo 267

Waste Dump Lights - Operation

Acceptable



Photo 268

Awning Lights - Operation

Acceptable

Underbelly Lights - Operation

Not Inspected

Under Slide Lights - Operation

Acceptable

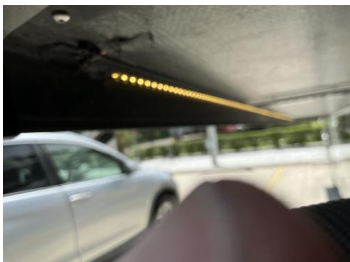


Photo 269



Photo 270



Photo 271

Front Cap Lights - Operation

Not Inspected

Appliances: Air Conditioners

Were any Air Conditioners Inspected?

Yes

Inspection Level

Complete

Air Conditioner

Air Conditioner 1

Air Conditioner - Location

Roof - Front

Air Conditioner - Brand

Dometic

Air Conditioner - Options

Air Conditioner with Heat Pump

Air Conditioner - Heat Pump/Strip Operation

Not Inspected

Too hot.

Air Conditioner - Delta T Test Performed

Yes

Air Conditioner - Supply Temperature



Photo 272

Air Conditioner - Return Temperature



Photo 273

Air Conditioner - Delta T

80-54=26

Air Conditioner - Operation

Acceptable

Air Conditioner 2

Air Conditioner - Location

Roof - Center

Air Conditioner - Brand	Dometic
Air Conditioner - Options	Air Conditioner with Heat Pump
Air Conditioner - Heat Pump/Strip Operation	Not Inspected
Too hot.	
Air Conditioner - Delta T Test Performed	Yes

Air Conditioner - Supply Temperature



Photo 274

Air Conditioner - Return Temperature



Photo 275

Air Conditioner - Delta T	78-56=22
Air Conditioner - Operation	Acceptable
Air Conditioner 3	
Air Conditioner - Location	Roof - Rear
Air Conditioner - Brand	Dometic
Air Conditioner - Options	Air Conditioner with Heat Pump
Air Conditioner - Heat Pump/Strip Operation	Not Inspected
Too hot	
Air Conditioner - Delta T Test Performed	Yes

Air Conditioner - Supply Temperature



Photo 276

Air Conditioner - Return Temperature



Photo 277

Air Conditioner - Delta T

78-52=26

Air Conditioner - Operation

Acceptable

Appliances: Furnace & Water Heater

Was a Furnace and/or Water Heater Inspected?

Yes

Inspection Level

Complete

Other Item

Other Item 1

Item - Description

Oasis

Item - Location

Basement

Item - Visual Condition

Acceptable

Item - Operation

Acceptable

Tested for hot water but not interior heating as the temperatures were too high in the coach and outside. Above 93 F.



Photo 278

Item - Sealant Condition

Acceptable - Sealant exhibits little to no signs of aging

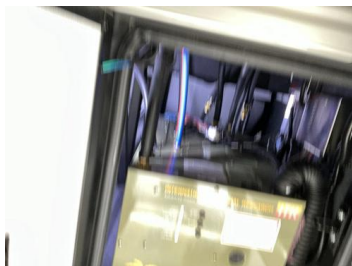


Photo 279

Appliances: Kitchen

Were any Kitchen Appliances Inspected?

Yes

Inspection Level

Complete

Refrigerator

Refrigerator 1

Refrigerator - Brand

Whirlpool



Photo 280

Refrigerator - Cooling Sources

120 Volts AC

Refrigerator - Operates on All Available Sources

Yes

Refrigerator - Exterior Visual Condition

Acceptable



Photo 281

Refrigerator - Fresh Food Compartment Visual Condition

Acceptable



Photo 282



Photo 283



Photo 284



Photo 285



Photo 286

Refrigerator - Freezer Compartment Visual Condition

Acceptable

Refrigerator - Frame

Refrigerator - Door Latch Secure

Yes

Ice Maker

Does the Unit Have an Ice Maker

Yes

Refrigerator - Ice Maker - Operation

Acceptable



Photo 287



Photo 288



Photo 289

Cooktop

Cooktop 1

Cooktop - Brand

True Induction



Photo 290



Photo 291

Cooktop - Burner Type

Induction

Cooktop - Operation

Acceptable

Microwave

Microwave 1

Microwave - Type

Convection Microwave

Microwave - Operation

Acceptable

Dishwasher

Dishwasher 1

Dishwasher - Brand

Fisher & Paykel

Dishwasher - Operation

Acceptable



Photo 292



Photo 293

Kitchen Sink

Was the Kitchen Sink Inspected?

Yes



Photo 294

Kitchen Sink - Faucet Operation

Acceptable

Kitchen Sink - Faucet Leaks at Stem

No

Kitchen Sink - Visible Signs of Water Damage Under Sink

No



Photo 295

Kitchen Sink - Hot & Cold Water Available

Yes



Photo 296

Appliances: Other	
Were any Other Appliances Inspected?	Yes
Inspection Level	Complete
Washer / Dryer	
Washer / Dryer 1	
Washer / Dryer - Type	Stackable (2 Appliances)
Washer - Brand	Splendide
Washer - Operation (Verify Wash & Rinse Cycle) IMG_7718.mov	Acceptable
Washer - Signs of Leaks or Damaged Hoses	No
Dryer - Brand 9DD4DBD0-E998-4ACE-BF9B-AC2B6EAC2076-video.mov	Splendide
Dryer - Operation	Acceptable
In-House Vacuum System	
In-House Vacuum System 1	
In-House Vacuum System - Brand	InterVac
   Photo 297 Photo 298 Photo 299	
In-House Vacuum System - Operation	Acceptable

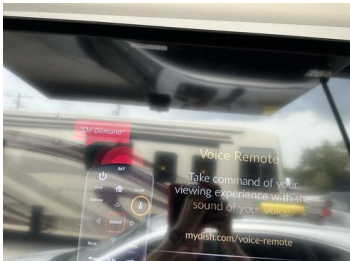
Electronics	
Were any Electronics Inspected?	Yes
Inspection Level	Complete
TV	
TV 1	
TV - Location	Patio
TV - Brand	Samsung
TV - Operation	Acceptable
 Photo 300	
TV Remote - Operational	Yes
TV 2	
TV - Location	Bedroom
  Photo 301 Photo 302	
TV - Brand	Samsung
TV - Operation	Acceptable
TV Remote - Operational	Yes
TV 3	
TV - Location	Cockpit



Photo 303

TV - Brand	Samsung
TV - Operation	Acceptable
TV Remote - Operational	Yes
TV 4	
TV - Location	Living Room
TV - Brand	Samsung
TV - Operation	Acceptable
TV Remote - Operational	Yes



Photo 304

Electrical System - 120 Volt AC & 12 Volt DC

1 flagged, 1 action

Was any of the 120 Volt AC & 12 Volt DC Electrical System Inspected?

Yes

Inspection Level

Complete

Power Source

50 Amp

Power Cord

Power Cord - Operation

Acceptable



Photo 305



Photo 306



Photo 307

Power Converter

Power Converter 1

Power Converter Inspected

Yes



Photo 308

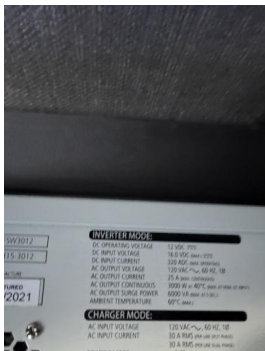


Photo 309

Power Converter - DC Voltage with Shore Power On

14.1

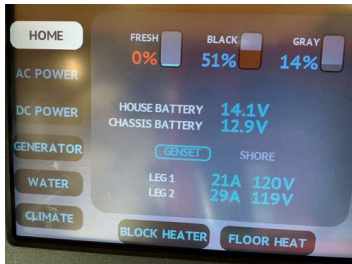


Photo 310

Power Converter - DC Voltage with Shore Power Off

13.4

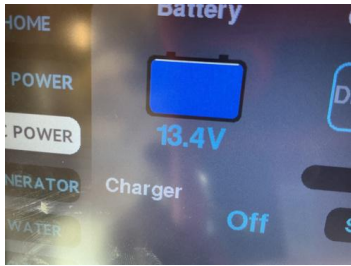


Photo 311

Power Converter - Operation

Acceptable

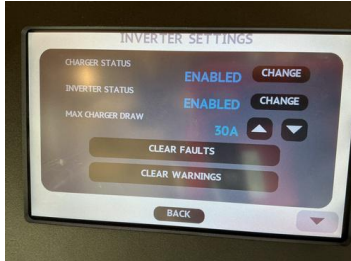


Photo 312

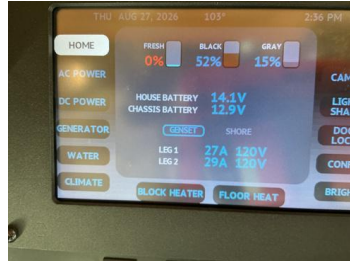


Photo 313

GFCI & Polarity / Voltage

1 flagged, 1 action

GFCI - Is a GFCI Circuit Breaker with a Test Button installed?

Yes

GFCI Circuit Breaker with a Test Button Trip Test - Result

Pass

Polarity / Voltage Test - Cockpit Receptacles

Not Present

GFCI Outlet Trip Test - Cockpit Receptacles

Not Inspected

Polarity / Voltage Test - Bath & Toilet Area Receptacles

Pass

GFCI Outlet Trip Test - Bath & Toilet Area Receptacles

Pass



Photo 314



Photo 315

[IMG_7713.mov](#)

Polarity / Voltage Test - Kitchen Receptacles

Pass



Photo 316



Photo 317

GFCI Outlet Trip Test - Kitchen Receptacles

Pass

Polarity / Voltage Test - Dining Area Receptacles

Not Present

Polarity / Voltage Test - Living Room Receptacles

Pass

Polarity / Voltage Test - Bedroom Receptacles

Fail

The bedroom, 120 V AC receptacles in the bedside table cupboards show an open ground.



Photo 318



Photo 319

To do | Priority: High | Created by: Geoffrey Baker

Bedroom Side Table electrical outlets.

Recommend RV Electrical technician repair the 120v AC outlets in the table cabinets by the master bedroom bed to cure the Open Ground condition.

Voltage Test - USB Ports & 12 Volt Plug-ins

Pass



Photo 320



Photo 321

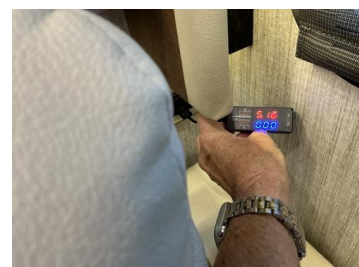


Photo 322



Photo 323



Photo 324

Polarity / Voltage Test - Storage Bay Area Receptacles

Pass



Photo 325

GFCI Outlet Trip Test - Storage Bay Receptacles

Pass

Polarity / Voltage Test - Exterior Receptacles

Not Present

GFCI Outlet Trip Test - All Exterior Receptacles

Not Inspected

Chassis Batteries

12 Volt DC Chassis Batteries - Operational

Yes



Photo 326



Photo 327



Photo 328

House Batteries

House Batteries - Operational

Yes

8x6v DC AGM Batteries installed.

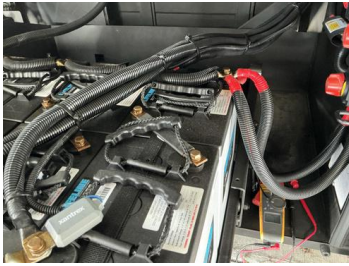


Photo 329



Photo 330



Photo 331

House Batteries - Water Levels

Not Inspected

Battery Monitor - Reading

13.0

Electrical Panel Box

Electrical Panel Box - Circuit Breakers in Place

Yes



Photo 332



Photo 333

Electrical Panel Box - Wiring with Signs of Discoloration from Heat

No

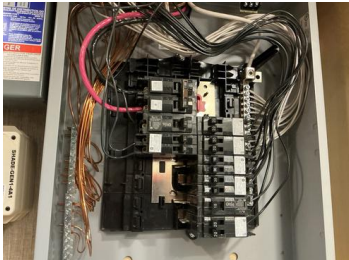


Photo 334



Photo 335

Electrical Panel Box - Wiring Secure

Yes

Fuse Panel Box

12 Volt DC Fuses - Operation

All Operational

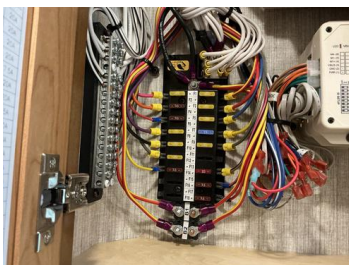


Photo 336

Power Inverter

Power Inverter 1

Power Inverter - Brand

Xantrax 3012

Power Inverter - Operation

Acceptable

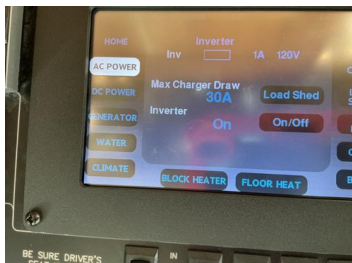


Photo 337



Photo 338



Photo 339



Photo 340

Generator

Generator 1

Generator - Brand

Onan QD12000



Photo 341



Photo 342



Photo 343



Photo 344



Photo 345

Generator - Starts & Runs

Yes

274 running hours.



Photo 346



Photo 347

Generator Transfer Switch - Operation

Acceptable



Photo 348

Water Systems

Were any of the Water Systems Inspected?

Yes

Inspection Level

Complete

Battery / Waste / Water Monitor Panel - Operation

Acceptable



Photo 349

Black Water Tank - Tank or Valve or Line Leaks

No



Photo 350

Gray Water Tank - Tank or Valve or Line Leaks

No

Fresh Water Tanks

Fresh Water Tanks 1

On-Board Water System - Pressure System Works

Yes



Photo 351

City Water

City Water - Connections Operate

Yes

City Water - System Holds Pressure

Yes

Outside Shower

Outside Shower 1

Outside Shower - Operation

Acceptable



Photo 352



Photo 353

Cockpit

2 flagged, 1 action

Was the Cockpit Inspected?

Yes

Inspection Level

Complete

Horn - Operation

Acceptable



Photo 354

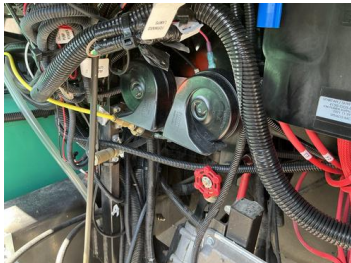


Photo 355

Windshield Wipers - Operation

Acceptable



Photo 356



Photo 357

[5EF6FEC5-D60B-4C72-8FFD-CA85FE171E20-video.mov](#)

Headlights - Operation

Acceptable



Photo 358

Side View Mirrors - Operation

Acceptable



Photo 359

Window Interior Shade - Operation

Acceptable



Photo 360



Photo 361

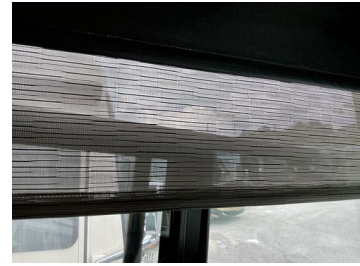


Photo 362

Fans - Operation

Acceptable



Photo 363

Side / Rear View Camera - Operation

Acceptable



Photo 364



Photo 365

Backup Camera - Operation

Acceptable



Photo 366

Dash Radio - Operational

Yes



Photo 367

Dash Air Conditioner - Operation

Acceptable



Photo 368

Dashes & Gauges - Operation

Acceptable

Note: not all the TPS system gauges are reading on the dash. This may be due to the Coach has been sitting for a while. Recommend checking tire air pressure before operating the vehicle.



Photo 369



Photo 370

Other Item

2 flagged, 1 action

Other Item 1

2 flagged, 1 action

Item - Description

Drivers Window

Item - Location

Cockpit

Item - Visual Condition

Poor

The electrical operating arm has become detached from the window. It does not work under electricity just manually.



Photo 371



Photo 372

[1FD19FD3-93B2-465B-A655-F0DE41790DCF-video.mov](#)

To do | Priority: Medium | Created by: Geoffrey Baker

Driver's window

Recommend repairing the driver's window as needed so that it operates from the dashboard switch.

Item - Operation

Poor

See previous note.

Item - Sealant Condition

Acceptable - Sealant exhibits little to no signs of aging

Interior		2 flagged, 4 actions
Was the Interior Inspected?		Yes
Inspection Level		Complete
Ceiling		
Was the Ceiling Inspected?		Yes
  		
Photo 373		Photo 374
Photo 375		
Ceiling - Panels Loose		No
Ceiling - Water Damaged Ceiling Panels		No
Ceiling - Excessive Discoloration or Stains		No
Ceiling - Vents - Operation of all Vent Lids		Acceptable
 		
Photo 376		Photo 377
Ceiling - Vents - Operation of all Vent Fans		Acceptable
Ceiling - Vents - Visual Condition		Acceptable
 		
Photo 378		Photo 379
Ceiling - Skylights - Visual Condition		Not Inspected
None present		

Ceiling - Operation of all 120 Volt AC Ceiling Fans

Not Inspected



Photo 380



Photo 381

Walls

Were the Interior Walls Inspected?

Yes



Photo 382



Photo 383

Walls - Panels Loose

No

Walls - Water Damaged Wall Panels

No

Walls - Soft Spots on Walls

No

Walls - Signs of Excessive Wear

No

Doors

Were any Interior Doors Inspected?

Yes



Photo 384



Photo 385



Photo 386



Photo 387

Doors - Damaged, Broken, or Missing

No

Doors - Operation

Acceptable

Windows

1 flagged, 1 action

Were any Windows Inspected?

Yes



Photo 388



Photo 389



Photo 390

Windows - Operation of All Windows

Acceptable

Windows - Operation of Window Coverings

Fair

The nightshade over the recliners in the living room does not extend and retract with the rest of the shades adjustment. Recommend recommended.



Photo 391

To do | Priority: Low | Created by: Geoffrey Baker

Living Room Night Shade behind recliners

Service shades to adjust extension and retraction as desired.

Is an Emergency Exit Window Installed?

Yes



Photo 392



Photo 393

Flooring

Was the Flooring Inspected?

Yes



Photo 394

Flooring - Signs of Excessive Wear

No

Flooring - Visible Signs of Water Damage

No

Flooring - Soft Spots in Floor

No

Interior Storage

1 action

Was any Interior Storage Inspected?

Yes



Photo 395



Photo 396



Photo 397

Cabinets

Cabinet Doors - Operation

Acceptable



Photo 398



Photo 399



Photo 400



Photo 401



Photo 402



Photo 403

Drawers

1 action

Drawers - Operation

Acceptable



Photo 404



Photo 405



Photo 406



Photo 407



Photo 408



Photo 409



Photo 410



Photo 411



Photo 412



Photo 413



Photo 414

To do | Priority: Low | Created by: Geoffrey Baker

Half Bath drawer by the toilet.

Clean out the drawer next to the toilet in the half bath.

Closets

Closet Doors - Operation

Acceptable



Photo 415

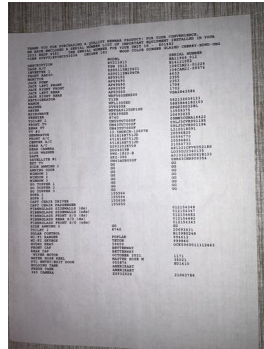


Photo 416



Photo 417

Standalone Dresser

Dresser Drawers - Operation

Acceptable

Dresser - Is It Securely Mounted

Yes

Counter Tops

Was any Counter Top Inspected?

Yes

Counter Tops - Visual Condition

Acceptable



Photo 418



Photo 419



Photo 420



Photo 421



Photo 422

Counter Tops - Securely Mounted	Yes
Lights & Light Fixtures	
Were the Interior Lights Inspected?	Yes
Lights & Light Fixtures - Operation of all Ceiling Mounted Light Fixtures	Acceptable
Lights & Light Fixtures - Operation of Under Cabinet Lights	Acceptable
Lights & Light Fixtures - Operation of all Wall Mounted Light Fixtures	Acceptable
Lights & Light Fixtures - Operation of Rope Accent Lights	Acceptable
Lights & Light Fixtures - Operation of Floor Lights	Acceptable
Lights & Light Fixtures - Operation of Entry Lights (inside of RV)	Acceptable
Safety Items	1 flagged, 2 actions
Is a Fire Extinguisher Installed?	Yes
	
Photo 423	
Is a Carbon Monoxide Detector Installed?	Yes
Carbon Monoxide Detector	1 flagged, 1 action
Carbon Monoxide Detector 1	1 flagged, 1 action
Is the Carbon Monoxide Detector a Combo Unit?	No

Carbon Monoxide Detector - Location

Bedroom ceiling

Carbon Monoxide Detector - Model

BRK CO2250RVA

Carbon Monoxide Detector - Age of Device

5-7 Years [Life Safety Issue]



Photo 424



Photo 425

To do | Priority: High | Created by: Geoffrey Baker

Carbon Monoxide Detector

Replace the CO detector and recommend labeling the expiration date on the cover for ease of inspection

Carbon Monoxide Detector - Test Method

Pushing the Test Button

Carbon Monoxide Detector - Test Result

Pass

Carbon Monoxide Detector - Visual Condition

Acceptable

Is a Liquid Propane Detector Installed?

Not Required

Is a Smoke Detector Installed?

Yes

Smoke Detector

1 action

Smoke Detector 1

1 action

Is the Smoke Detector a Combo Unit?

No

Smoke Detector

1 action

Smoke Detector - Location

Ceiling in cockpit.

Smoke Detector - Model

BRK FG100 RV

Smoke Detector - Age of Device

1-10 Years [For 10 Year Models]



Photo 426

Smoke Detector - Test Result

Pass

To do | Priority: High | Created by: Geoffrey Baker

Smoke Detector

The battery is depleted. Replace the battery before occupying the RV.

Smoke Detector - Visual Condition

Acceptable

Furniture	
Was any Furniture Inspected?	Yes
Inspection Level	Complete
Cockpit Chairs	
Cockpit Chairs 1	
Cockpit Chair	Driver Chair
Cockpit Chair - Position	Able to Swivel
   Photo 427 Photo 428 Photo 429	
Cockpit Chair - Swivel Operation	Acceptable
Cockpit Chair - Signs of Excessive Wear	No
Cockpit Chair - Seatbelt Operation	Acceptable
 Photo 430	
Cockpit Chairs 2	
Cockpit Chair	Passenger Chair



Photo 431



Photo 432



Photo 433

Cockpit Chair - Position

Able to Swivel



Photo 434



Photo 435

Cockpit Chair - Swivel Operation

Acceptable

Cockpit Chair - Signs of Excessive Wear

No

Cockpit Chair - Seatbelt Operation

Acceptable



Photo 436

Dining / Work Area

Dining / Work Area 1

Dining / Work Area - Location

Main Cabin

Dining / Work Area - Type

Attached Table & Standalone
Chairs



Photo 437

Table - Visual Condition

Acceptable



Photo 438



Photo 439

Chairs - Signs of Excessive Wear

No

Seating

Seating 1

Seating - Location

Main Cabin

Seating - Type

Recliner



Photo 440

Recliner - Signs of Excessive Wear

No

Recliner - Visible Signs of Water Damage

No

Recliner - Operation

Acceptable



Photo 441

Seating 2

Seating - Location

Main Cabin



Photo 442

Seating - Type

Sofa

Sofa - Signs of Excessive Wear

No

Sofa - Visible Signs of Water Damage

No

Sofa - Convert into Bed

Yes



Photo 443



Photo 444



Photo 445



Photo 446



Photo 447

Sofa Mattress - Type

Sofa Cushions

Sofa Conversion - Operation

Acceptable

Beds	
Were any Beds Inspected?	Yes
Inspection Level	Complete
Beds	
Beds 1	
Bed - Location	Main Bedroom
Bed - Lift Type	Bed Strut
	
Photo 448	
Bed - Lift Operation	Acceptable
Two additional chairs for the dining room are stored under the master bed	
Bed - Visual Condition	Acceptable
	
	
Photo 449	
Photo 450	
Mattress - Present	Yes
Mattress - Visual Condition	Acceptable



Photo 451



Photo 452

Bathroom

Was a Bathroom Inspected?

Yes

Inspection Level

Complete

Bathroom

Bathroom 1

Bathroom - Location

Center



Photo 453

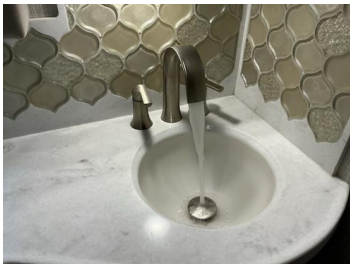


Photo 454



Photo 455

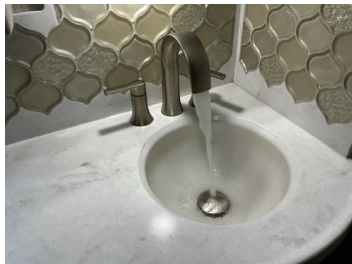


Photo 456



Photo 457



Photo 458



Photo 459



Photo 460



Photo 461



Photo 462

Bathroom - Type	Half Bath
Toilet	
Was the Toilet Inspected?	Yes
Toilet - Bowl Holds Water	Yes
Toilet - Mounting Problems	No
Toilet - Operation	Acceptable
Bathroom Sink	
Was the Bathroom Faucet / Sink Inspected?	Yes
Bathroom Sink - Faucet Operation	Acceptable
Bathroom Sink - Faucet Leaks at Stem	No
Bathroom Sink - Water Damage Under the Sink	No
Bathroom Sink - Hot & Cold Water Available	Yes
Bathroom 2	
Bathroom - Location	Rear
Bathroom - Type	Full Bath
	
Photo 463	
Toilet	
Was the Toilet Inspected?	Yes



Photo 464



Photo 465



Photo 466

Toilet - Bowl Holds Water

Yes

Toilet - Mounting Problems

No

Toilet - Operation

Acceptable

Bathroom Sink

Was the Bathroom Faucet / Sink Inspected?

Yes



Photo 467



Photo 468

Bathroom Sink - Faucet Operation



Photo 469



Photo 470



Photo 471



Photo 472

Bathroom Sink - Faucet Leaks at Stem

No

Bathroom Sink - Water Damage Under the Sink

No



Photo 473



Photo 474

Bathroom Sink - Hot & Cold Water Available

Yes



Photo 475

Shower / Tub

Was the Shower / Tub Inspected?

Yes



Photo 476



Photo 477



Photo 478



Photo 479



Photo 480

Shower / Tub - Shower Head / Spigot Operation



Photo 481



Photo 482



Photo 483

Shower / Tub - Water Damage or Leaks

No

Shower / Tub - Door Latch Operation

Acceptable



Photo 484

Exterior Kitchen

Was the Exterior Kitchen Inspected?

No

Fold-Down Patio

Was a Fold-Down Patio Inspected?

No

Toy Hauler	
Garage Interior	
Was the Garage Interior Inspected?	No
Loft Area	
Was the Loft Area Inspected?	No
Cargo Door / Ramp	
Was the Cargo Door / Ramp Inspected?	No

Media summary



Photo 1



Photo 2



Photo 3

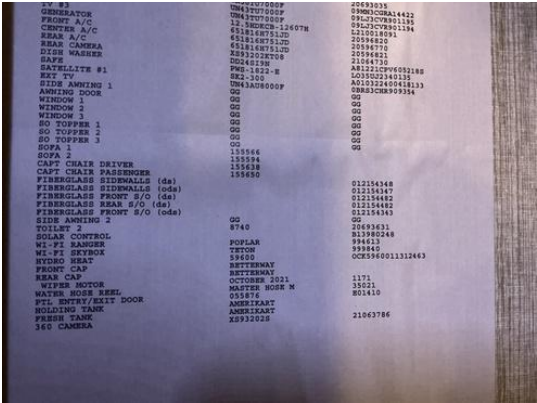


Photo 4



Photo 5



Photo 6



Photo 7



Photo 8



Photo 9



Photo 10



Photo 11



Photo 12



Photo 13



Photo 14



Photo 15



Photo 16



Photo 17



Photo 18



Photo 19



Photo 20



Photo 21



Photo 22



Photo 23



Photo 24



Photo 25



Photo 26



Photo 27



Photo 28



Photo 29

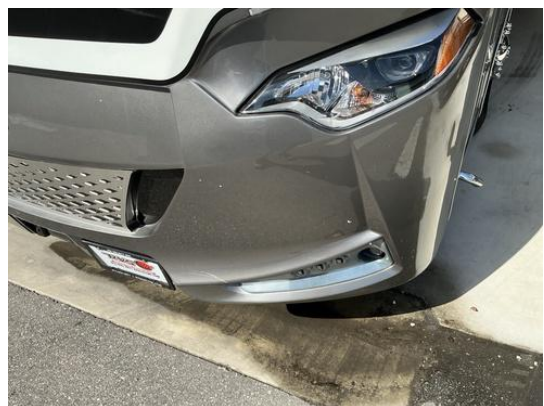


Photo 30



Photo 31



Photo 32



Photo 33

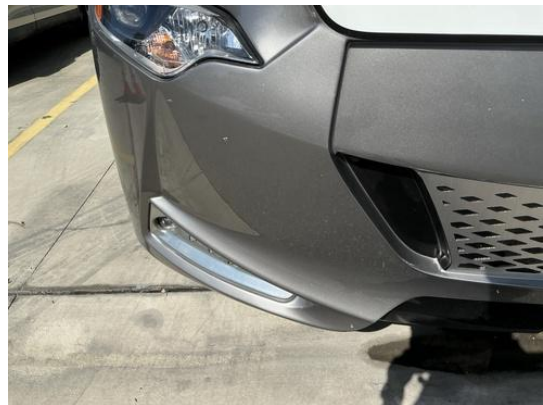


Photo 34



Photo 35



Photo 36



Photo 37



Photo 38



Photo 39



Photo 40



Photo 41



Photo 42



Photo 43



Photo 44



Photo 45



Photo 46



Photo 47



Photo 48



Photo 49



Photo 50

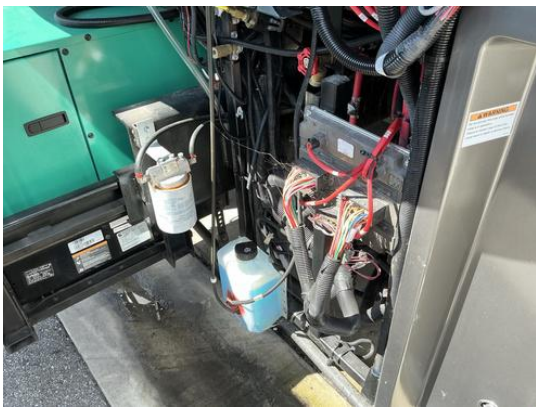


Photo 51



Photo 52



Photo 53



Photo 54

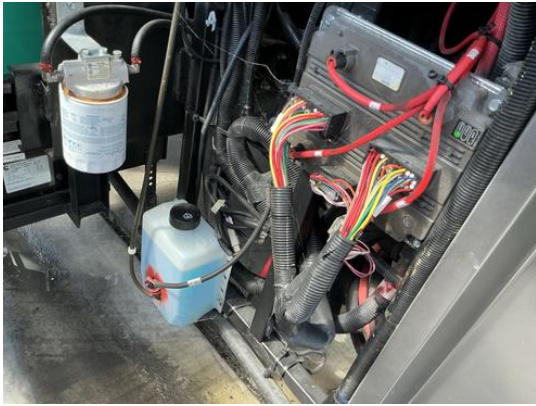


Photo 55



Photo 56

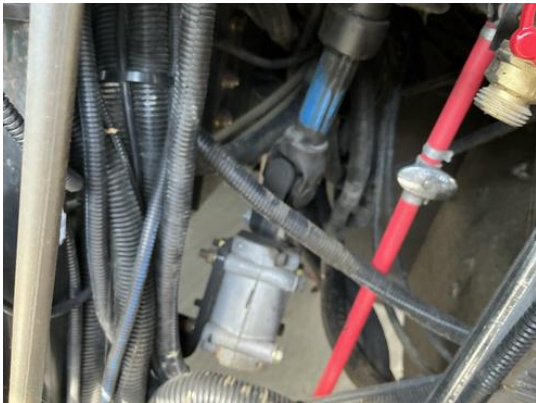


Photo 57

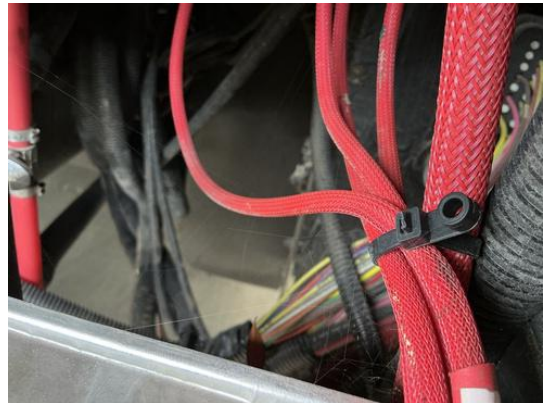


Photo 58



Photo 59



Photo 60



Photo 61



Photo 62



Photo 63



Photo 64



Photo 65



Photo 66



Photo 67



Photo 68



Photo 69



Photo 70



Photo 71



Photo 72



Photo 73



Photo 74



Photo 75



Photo 76



Photo 77



Photo 78



Photo 79



Photo 80



Photo 81



Photo 82



Photo 83



Photo 84



Photo 85



Photo 86



Photo 87



Photo 88



Photo 89



Photo 90



Photo 91



Photo 92



Photo 93



Photo 94

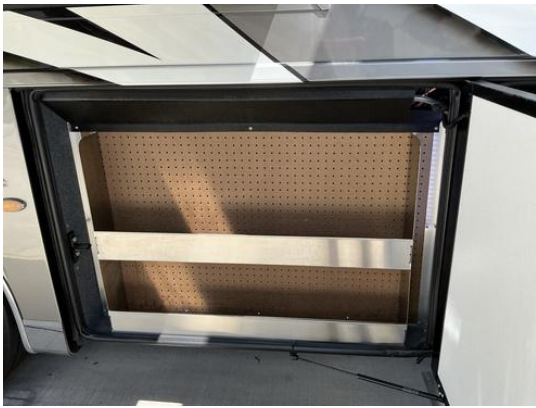


Photo 95

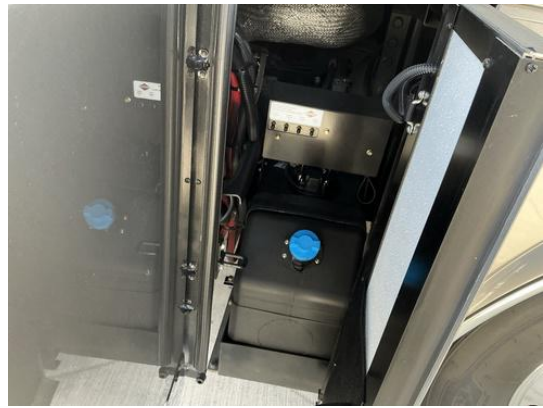


Photo 96



Photo 97



Photo 98



Photo 99



Photo 100



Photo 101



Photo 102

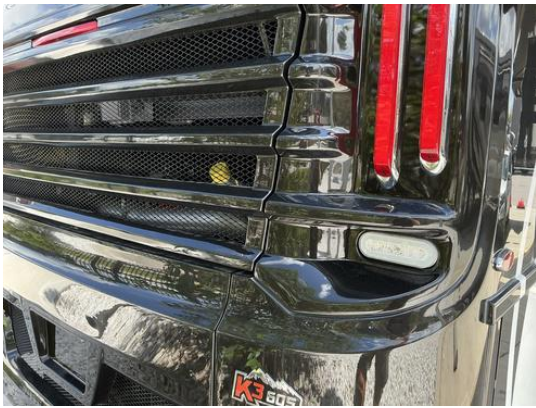


Photo 103



Photo 104

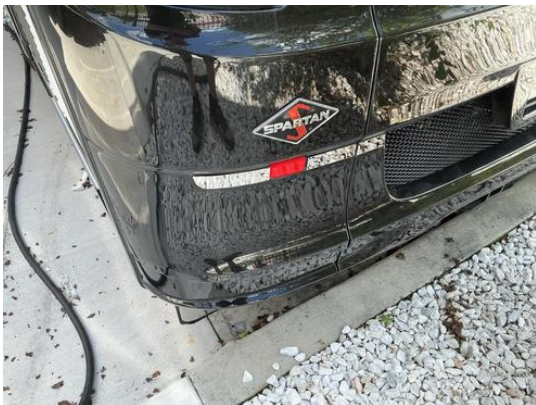


Photo 105



Photo 106



Photo 107



Photo 108

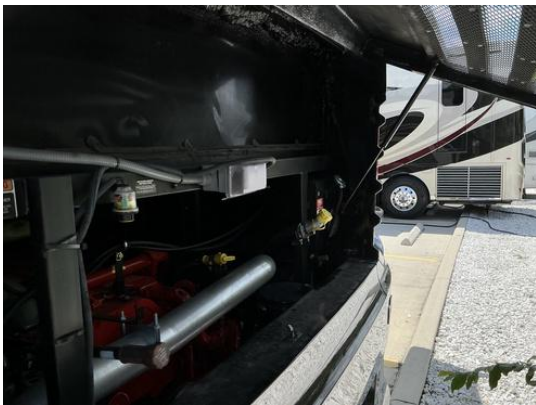


Photo 109



Photo 110



Photo 111



Photo 112



Photo 113



Photo 114



Photo 115



Photo 116



Photo 117



Photo 118



Photo 119



Photo 120



Photo 121



Photo 122

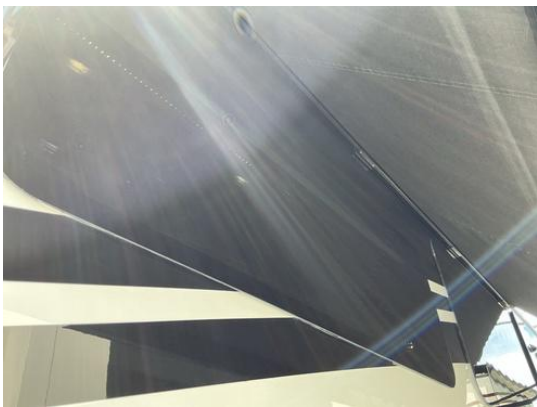


Photo 123



Photo 124



Photo 125



Photo 126



Photo 127



Photo 128



Photo 129



Photo 130

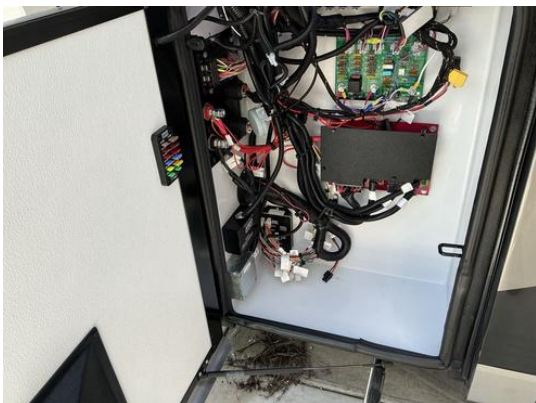


Photo 131



Photo 132

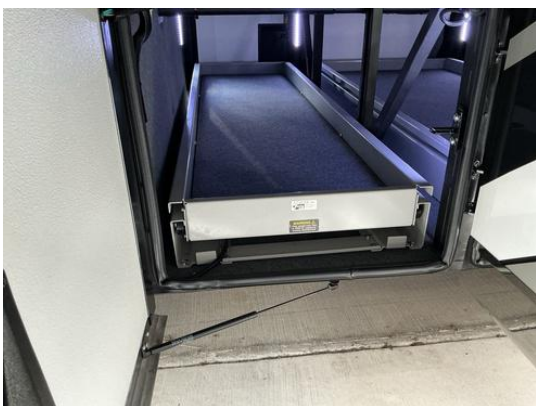


Photo 133



Photo 134



Photo 135



Photo 136



Photo 137



Photo 138

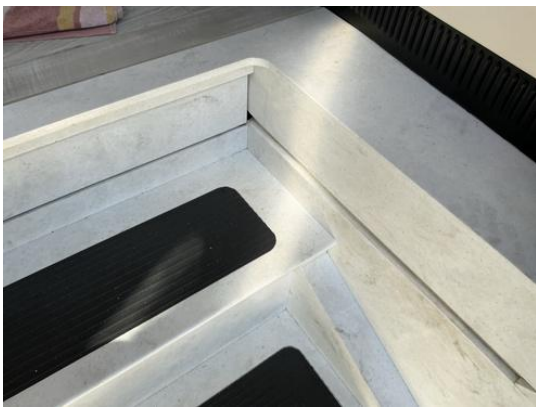


Photo 139



Photo 140



Photo 141



Photo 142



Photo 143



Photo 144



Photo 145



Photo 146



Photo 147



Photo 148



Photo 149



Photo 150



Photo 151



Photo 152



Photo 153



Photo 154



Photo 155



Photo 156



Photo 157



Photo 158



Photo 159



Photo 160



Photo 161



Photo 162

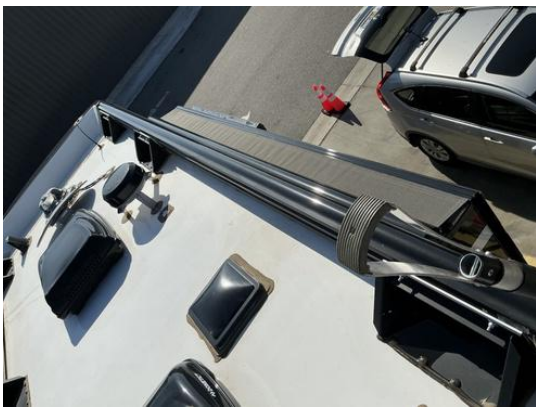


Photo 163



Photo 164



Photo 165



Photo 166



Photo 167



Photo 168



Photo 169



Photo 170



Photo 171



Photo 172



Photo 173



Photo 174



Photo 175



Photo 176



Photo 177



Photo 178



Photo 179

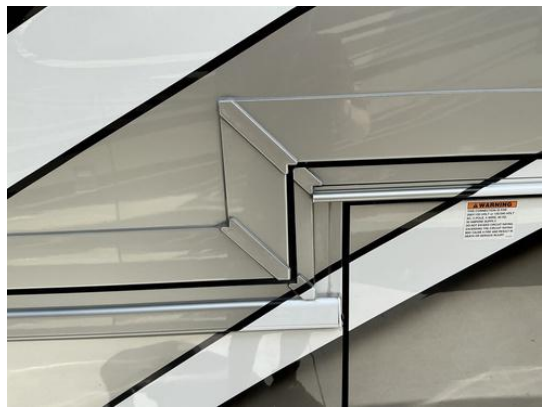


Photo 180



Photo 181



Photo 182



Photo 183



Photo 184



Photo 185



Photo 186



Photo 187



Photo 188



Photo 189



Photo 190



Photo 191



Photo 192



Photo 193



Photo 194



Photo 195



Photo 196



Photo 197



Photo 198



Photo 199



Photo 200



Photo 201



Photo 202



Photo 203



Photo 204



Photo 205



Photo 206



Photo 207



Photo 208



Photo 209



Photo 210



Photo 211



Photo 212



Photo 213



Photo 214



Photo 215

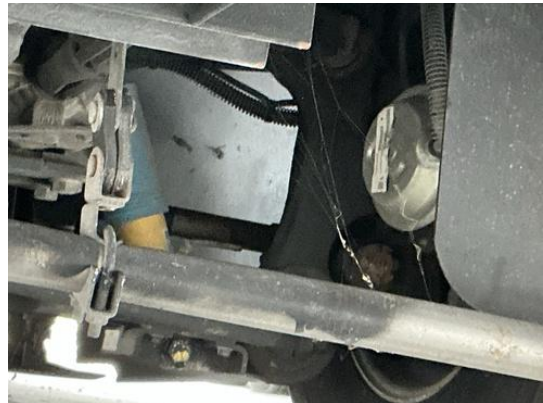


Photo 216



Photo 217

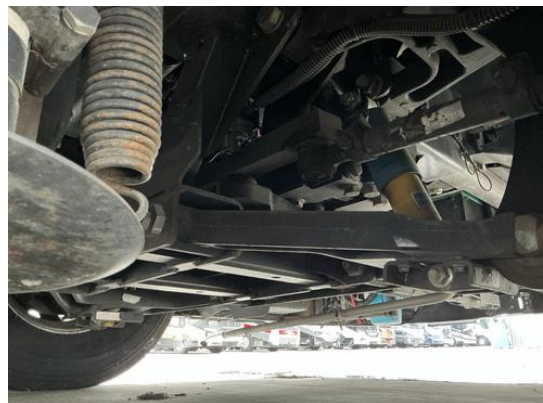


Photo 218

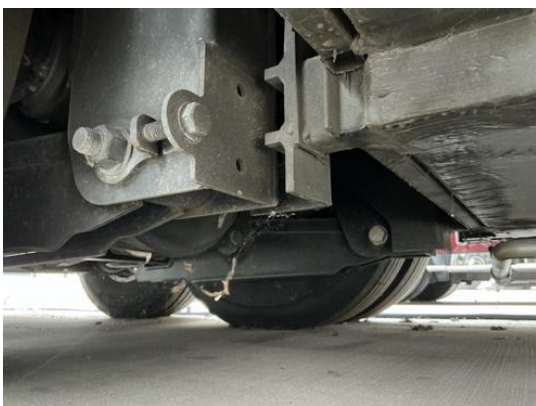


Photo 219



Photo 220



Photo 221



Photo 222



Photo 223



Photo 224



Photo 225



Photo 226



Photo 227



Photo 228



Photo 229



Photo 230



Photo 231

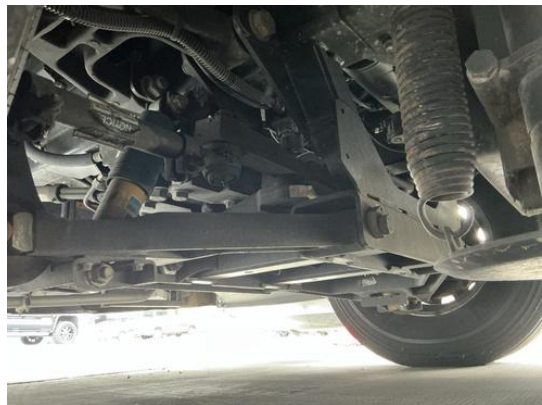


Photo 232



Photo 233



Photo 234

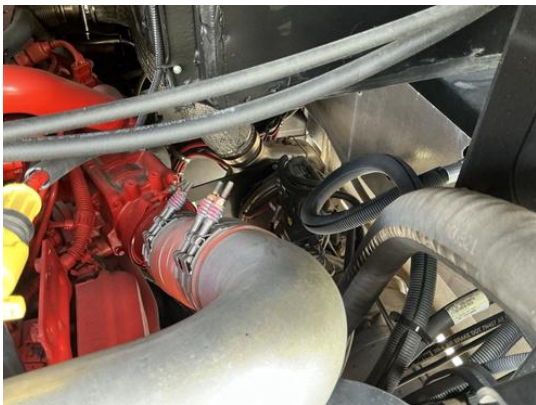


Photo 235



Photo 236



Photo 237



Photo 238



Photo 239



Photo 240



Photo 241



Photo 242



Photo 243



Photo 244



Photo 245

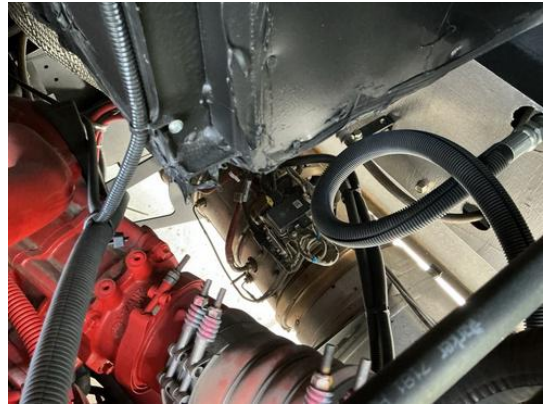


Photo 246



Photo 247



Photo 248



Photo 249



Photo 250



Photo 251



Photo 252



Photo 253



Photo 254



Photo 255



Photo 256



Photo 257



Photo 258



Photo 259



Photo 260

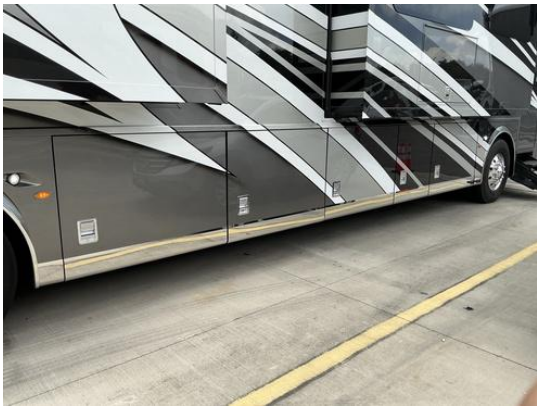


Photo 261



Photo 262



Photo 263



Photo 264



Photo 265



Photo 266



Photo 267



Photo 268



Photo 269



Photo 270

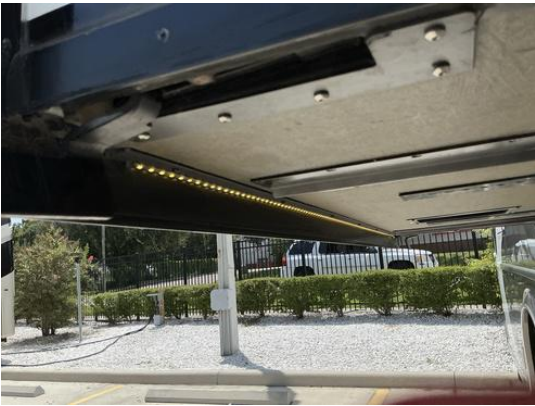


Photo 271



Photo 272



Photo 273



Photo 274



Photo 275



Photo 276



Photo 277



Photo 278



Photo 279



Photo 280



Photo 281



Photo 282



Photo 283



Photo 284



Photo 285

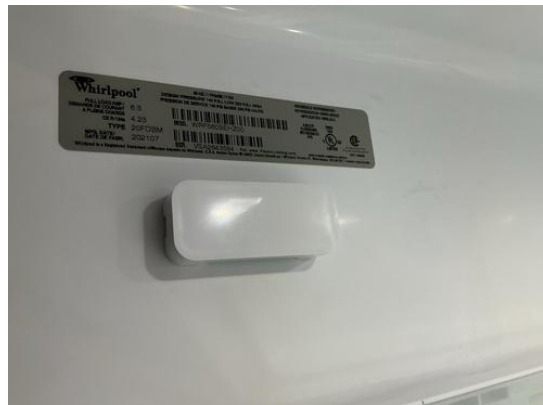


Photo 286



Photo 287



Photo 288



Photo 289

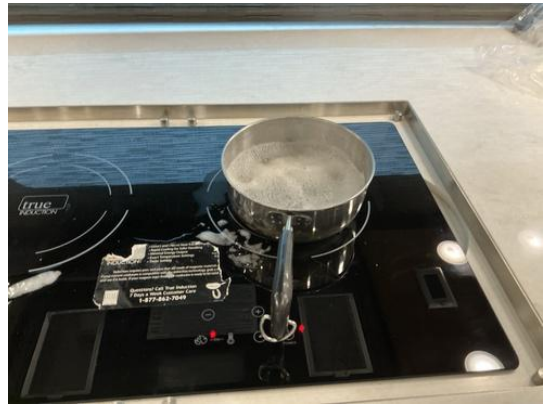


Photo 290



Photo 291



Photo 292



Photo 293



Photo 294



Photo 295



Photo 296



Photo 297



Photo 298



Photo 299



Photo 300



Photo 301



Photo 302



Photo 303



Photo 304



Photo 305



Photo 306



Photo 307



Photo 308

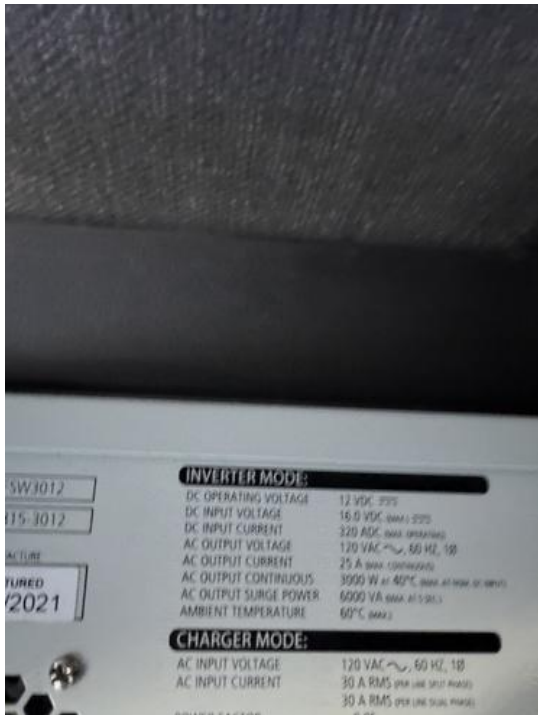


Photo 309

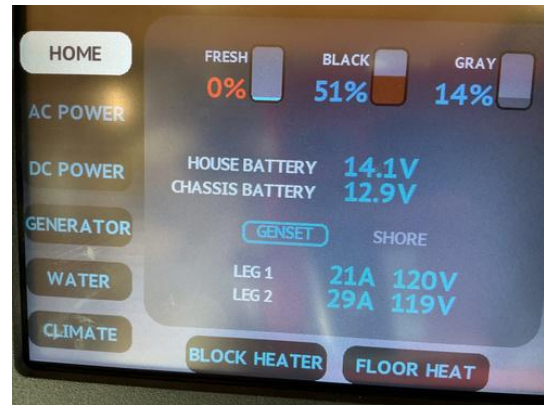


Photo 310



Photo 311



Photo 312



Photo 313



Photo 314



Photo 315



Photo 316



Photo 317



Photo 318



Photo 319



Photo 320



Photo 321

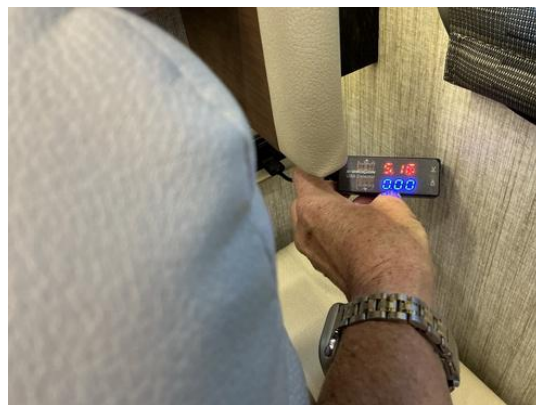


Photo 322



Photo 323



Photo 324



Photo 325



Photo 326



Photo 327



Photo 328

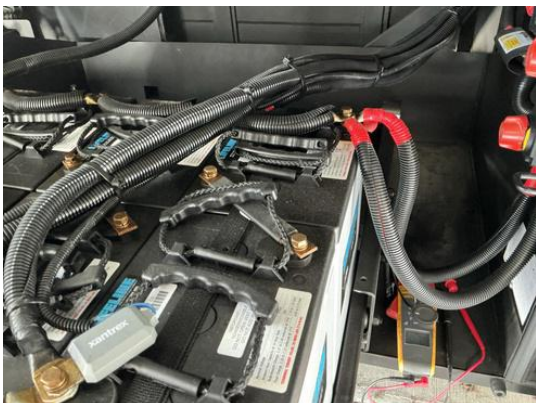


Photo 329



Photo 330



Photo 331



Photo 332

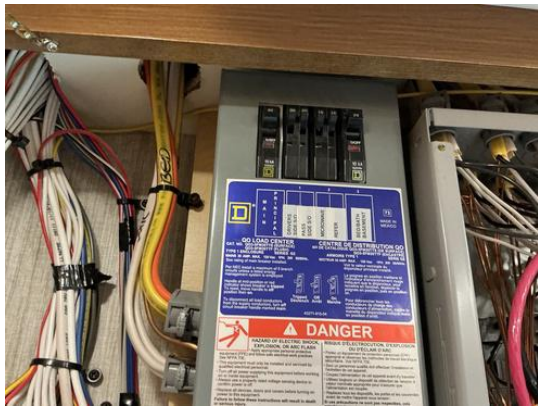


Photo 333

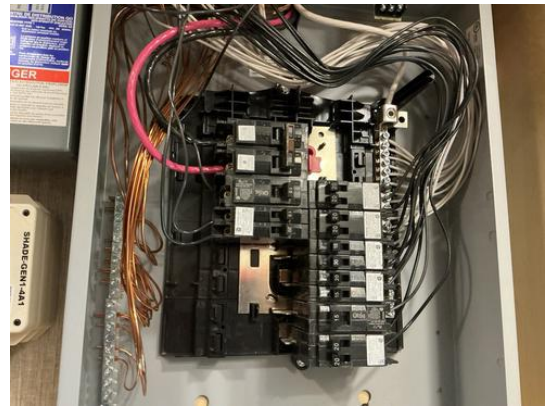


Photo 334



Photo 335

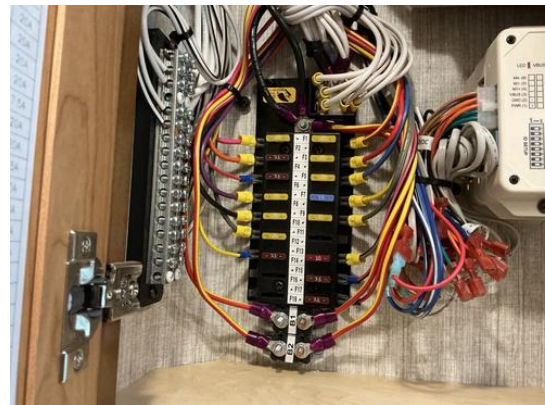


Photo 336

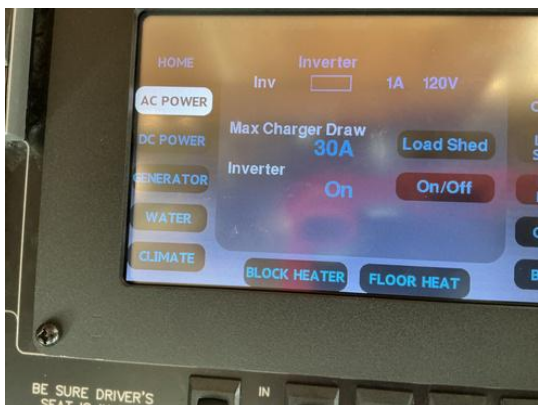


Photo 337



Photo 338



Photo 339



Photo 340



Photo 341



Photo 342



Photo 343



Photo 344



Photo 345



Photo 346



Photo 347



Photo 348



Photo 349



Photo 350



Photo 351



Photo 352

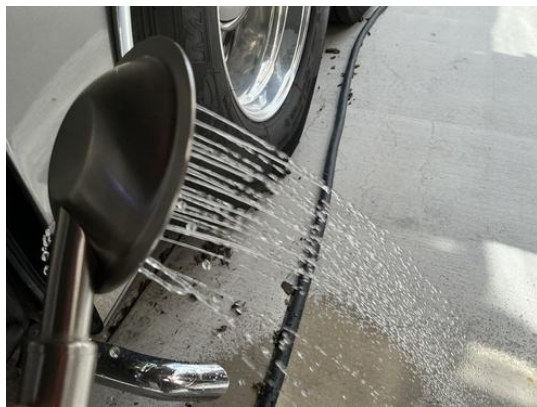


Photo 353



Photo 354

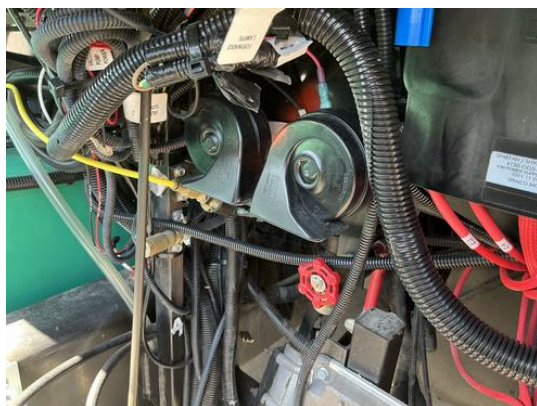


Photo 355



Photo 356



Photo 357



Photo 358



Photo 359



Photo 360

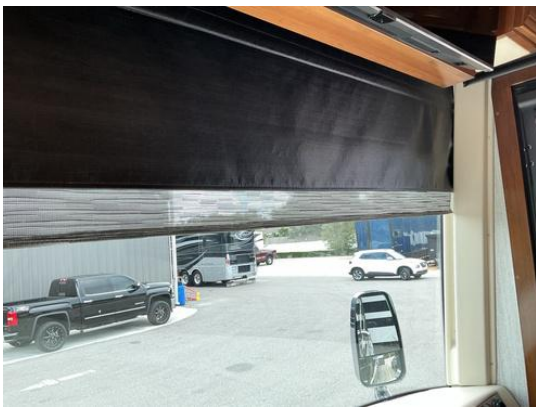


Photo 361



Photo 362



Photo 363



Photo 364



Photo 365

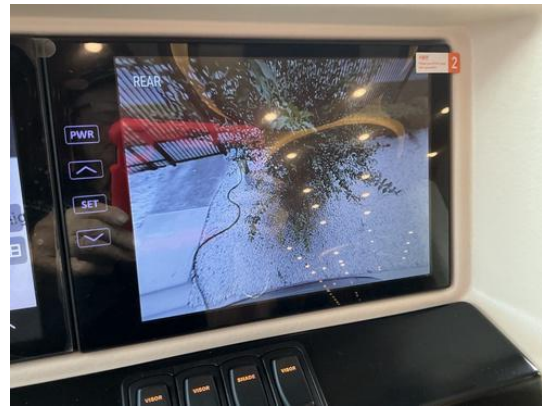


Photo 366



Photo 367



Photo 368



Photo 369



Photo 370



Photo 371



Photo 372



Photo 373



Photo 374



Photo 375



Photo 376



Photo 377



Photo 378



Photo 379



Photo 380



Photo 381



Photo 382



Photo 383



Photo 384



Photo 385



Photo 386



Photo 387



Photo 388



Photo 389



Photo 390



Photo 391



Photo 392

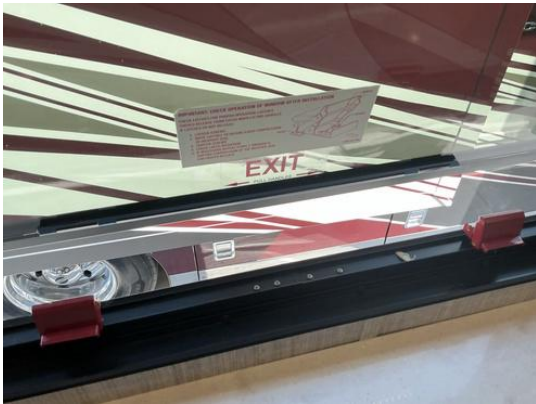


Photo 393



Photo 394



Photo 395



Photo 396



Photo 397



Photo 398



Photo 399



Photo 400



Photo 401



Photo 402



Photo 403



Photo 404



Photo 405



Photo 406



Photo 407



Photo 408



Photo 409



Photo 410



Photo 411



Photo 412



Photo 413



Photo 414



Photo 415

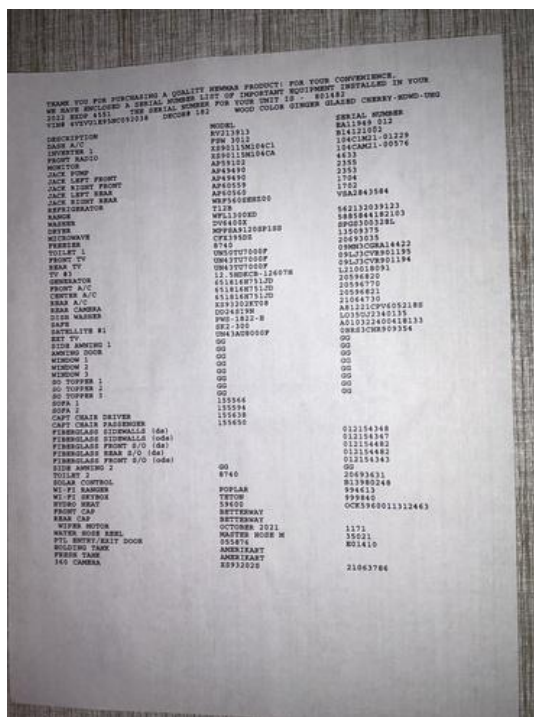


Photo 416



Photo 417



Photo 418



Photo 419



Photo 420



Photo 421



Photo 422



Photo 423



Photo 424



Photo 425



Photo 426



Photo 427



Photo 428



Photo 429



Photo 430



Photo 431



Photo 432



Photo 433



Photo 434



Photo 435



Photo 436



Photo 437



Photo 438



Photo 439



Photo 440



Photo 441



Photo 442



Photo 443



Photo 444



Photo 445



Photo 446



Photo 447



Photo 448



Photo 449



Photo 450



Photo 451



Photo 452



Photo 453



Photo 454



Photo 455



Photo 456



Photo 457



Photo 458



Photo 459



Photo 460



Photo 461



Photo 462



Photo 463



Photo 464



Photo 465



Photo 466



Photo 467



Photo 468



Photo 469



Photo 470



Photo 471



Photo 472



Photo 473



Photo 474



Photo 475



Photo 476



Photo 477



Photo 478



Photo 479



Photo 480



Photo 481



Photo 482



Photo 483



Photo 484

File summary

[09A832A0-D82D-48A1-880B-B3834BE65999-video.mov](#)
[4C860D0C-7FC7-4F11-8B1B-1D73343523E7-video.mov](#)

[IMG_7718.mov](#)

[9DD4DBD0-E998-4ACE-BF9B-AC2B6EAC2076-video.mov](#)

[IMG_7713.mov](#)

[5EF6FEC5-D60B-4C72-8FFD-CA85FE171E20-video.mov](#)

[1FD19FD3-93B2-465B-A655-F0DE41790DCF-video.mov](#)