



JACKRABBIT RV
Mobile RV Repair and Maintenance
602-429-9221
hello@jackrabbitrv.com

Date: Jul 10, 2026
Report #: 9

CUSTOMER: Jason Chill
PHONE: 123-456-7890
EMAIL: jason@chill.com
ADDRESS: Desert sands rv park, 306

RV: 2022 Grand Design Reflection
TECHNICIAN: Tim Bourdage

TECHNICIAN ASSESSMENT

Both air conditioners are operating normally and cooling efficiently. No repairs are recommended at this time. Annual maintenance is recommended to maintain peak performance and maximize equipment life.

RECOMMENDED FOLLOW-UP

Schedule your next A/C Performance Tune-Up in approximately 12 months to maintain efficiency, maximize component life, and identify developing issues before they become costly repairs.

OVERALL CONDITION: Good

 RV AIR CONDITIONER CARE TIPS

► Pre-cool early Start the AC before the day heats up — it maintains temp, not catch-up.	► Rinse filters every 2 weeks Clogged foam filters reduce airflow and can freeze the coils.	► Know the 20° rule AC drops ~15–20°F. At 100°F outside, expect ~80°F inside — not 70°F.
► Park in shade Shade, closed blinds, and skylight covers cut your AC's workload significantly.	► Use the dump vent Open ceiling dump to fast-cool; close it to push air to the bedroom.	► Schedule yearly service Annual checks catch weak capacitors and dirty coils before they fail.

UNIT 1 — LIVING ROOM — DOMETIC BRISK 2 — S/N: 123456

DELTA-T / AIRFLOW			CAPACITOR (TWO SEPARATE)			
	Before	After		Measured	Rated	Condition
Supply Air Temp	85°F	85°F	Compressor Cap	54 µF	55 µF	Good
Return Air Temp	70°F	65°F	Fan Cap	7.5 µF	7.5 µF	Good
Delta-T	-15°F	-20°F				

COMPRESSOR				
NAMEPLATE RLA 10 A	AMBIENT TEMP 90°F	EXPECTED AMPS 9.5 A	MEASURED BEFORE 12 A	MEASURED AFTER 9.5 A
Windings: R-S: 1.5 Ω R-C: 2.5 Ω S-C: 4 Ω				

FAN MOTOR		COIL & FILTER CONDITION		
CONDITION Good	AMPS 3 A	EVAPORATOR Cleaned	CONDENSER Cleaned	FILTER Good


UNIT NOTES
Coils dirty, cleaned amd straightened fina

PHOTOS

EVAPORATOR BEFORE



EVAPORATOR AFTER

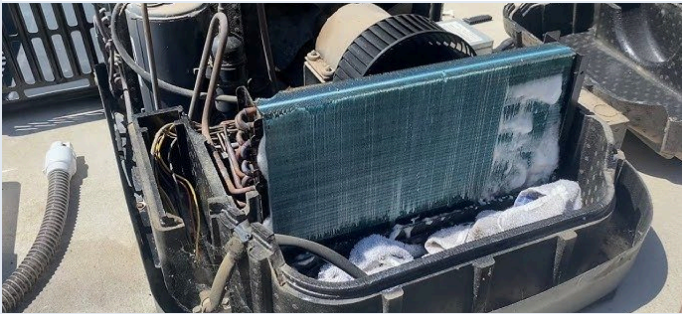

CONDENSER BEFORE



CONDENSER AFTER

